

**Product: Decca BridgeMaster E Series Radars**

**Subject: Interswitch Unit type 65842A**

## **IMPORTANT INFORMATION**

A minor anomaly has been discovered with the 65842A 4x2 way Interswitch with version 2.0 software.

The symptoms are as follows:

If the system is used with 2 Displays and 2 Transceivers, with the switches placed in the positions stated in the manual (Ancillary Units, ref: 65800012, Chapter 3, page 3-4), the Interswitch would not recognise Display A, and an Interswitch error message would appear on the screen of Display A. If the system used more than 2 displays then the Interswitch would operate correctly.

A revised software has been released (version 2.2) and all new units will have the new software fitted.

**THERE IS NO RETROSPECTIVE ACTION REQUIRED. THERE IS NO NEED TO UPGRADE THE SOFTWARE ON ANY EXISTING UNITS.**

A simple fix is to set all 4 switches on SW1 (DUA, DUB, DUC, DUD) to the **OFF** position (i.e. All 4 Displays are FITTED).

*Note: There will be NO visual difference on the Display's Interswitch menu.*